


If you snap the M10 charging cable on your M2 machine gun, charging and firing stops.

Don't jerk the cable back. That can snap the cable if the bolt hangs up. A steady pull on the cable should be enough to lock the bolt back. If you feel resistance, stop. Ride the bolt forward, put your M2 on SAFE, open the feed cover, and see what the problem is. The feed selector is probably set to the wrong feed. If it's not, tell your armorer.

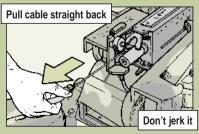

Pull the cable back as straight as possible. If you pull the cable at an angle, it rubs and soon begins fraying. A frayed cable deadlines your M2, plus it can cut you.

Guide the cable back when you release it. If you let it snap back, the cable hits the edges of the pulley swivel and frays or breaks.

Don't wrap the cable around anything. That causes the cable to kink and fray.

Help the cable last by giving it a light coat of LAW or LSA when you clean your M2.

